D4152-C




NOTES:
1. BRACES 40572-4 & 40572-5 SHALL BE TAUT.
2. HINGE CENTERS TO COINCIDE WITH THOSE ON 40643.







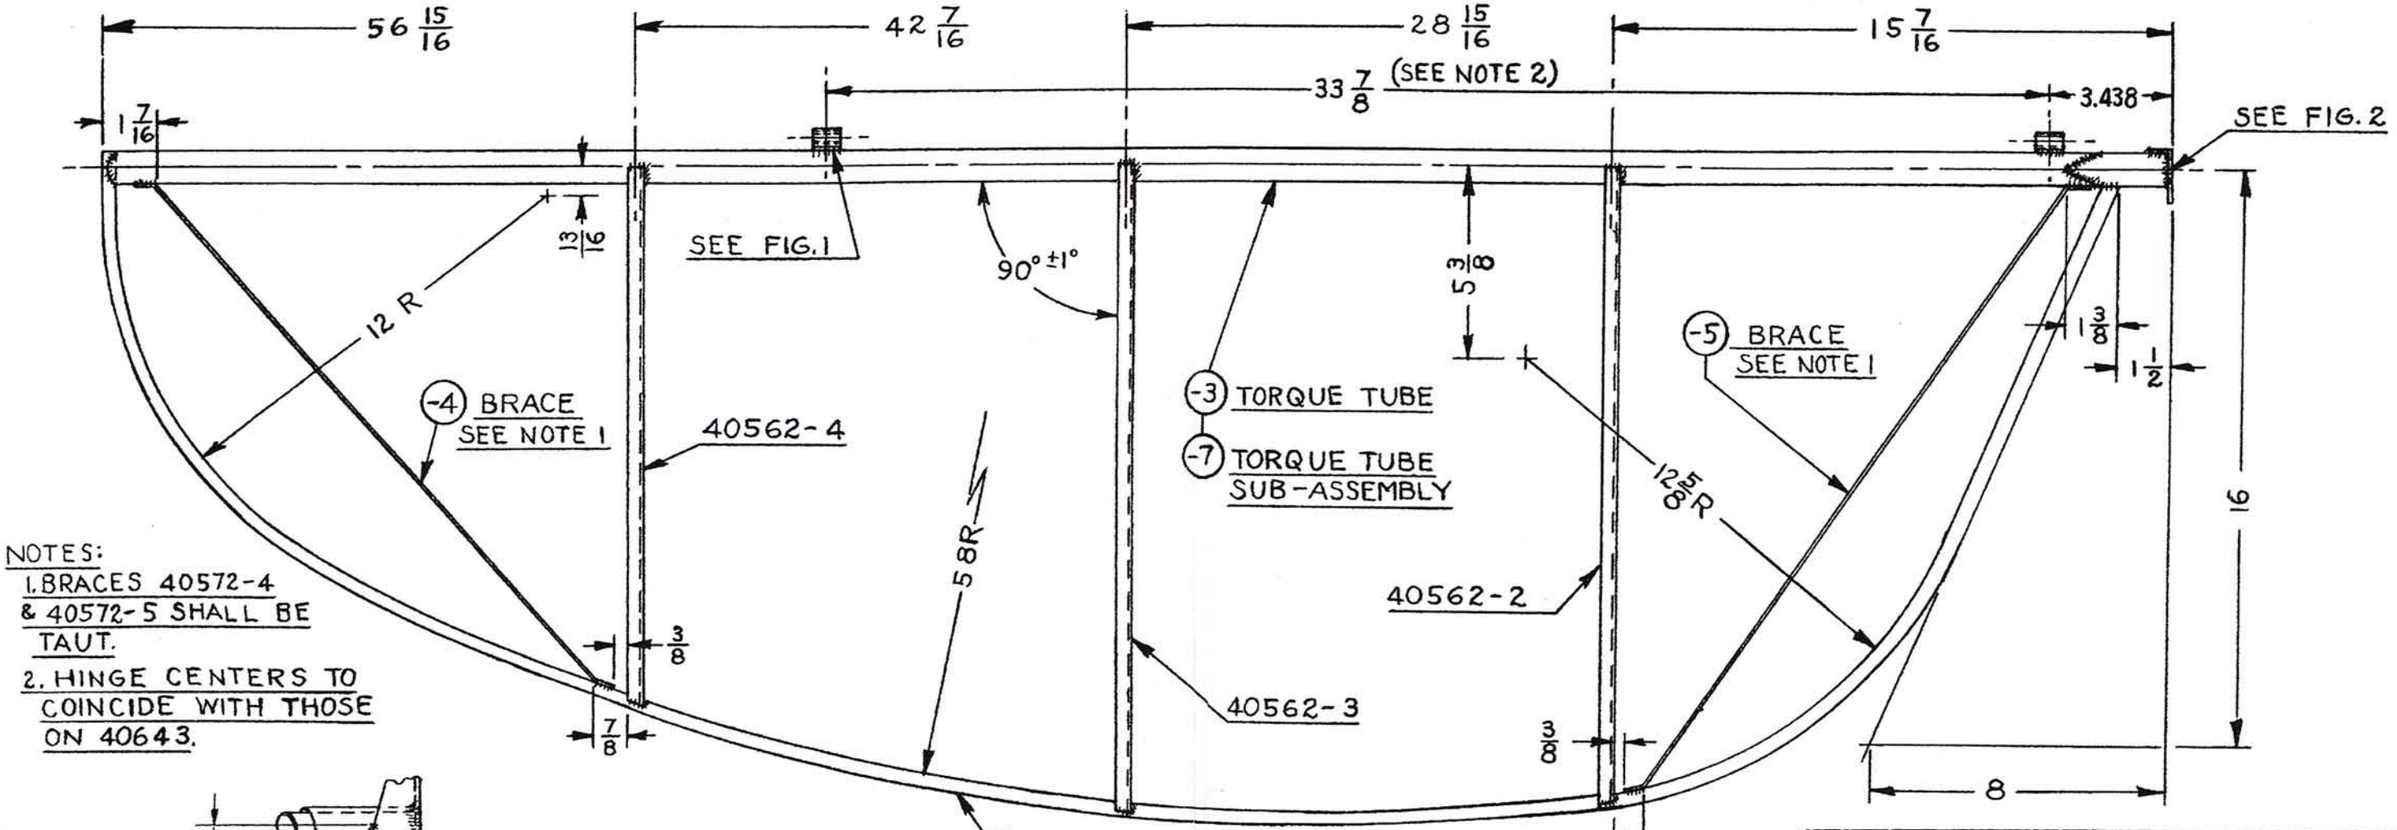


FIG. 2
HORN ATTACHMENT DETAIL
6IN=1FT.

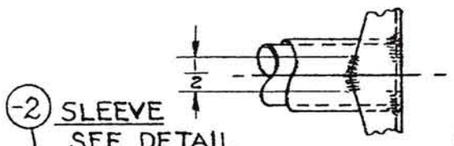


FIG. 1
HINGE DETAIL
6IN=1FT.

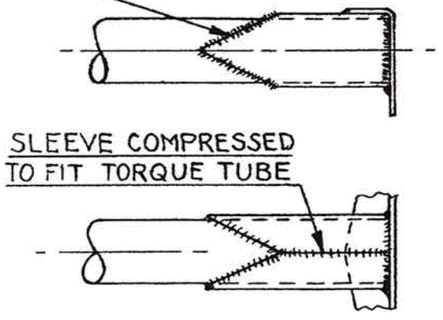NOTE:
3. MAGNETIC INSPECTION REQUIRED

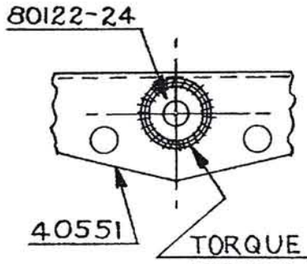


-2 DETAIL
6IN.=1FT.

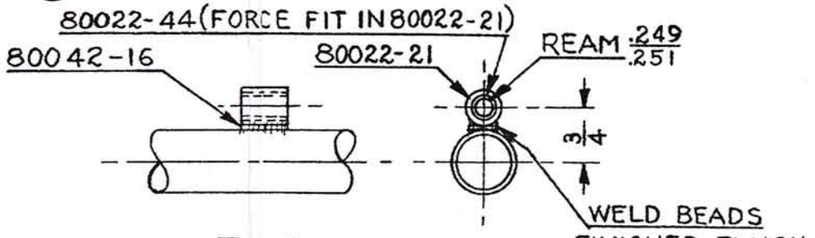LIMITS, SHOP PRACTICES AND FINISH, UNLESS OTHERWISE NOTED, TO BE IN ACCORDANCE WITH PIPER SPECIFICATIONS #9 AND #19.

| PART NO. | NO. REQ. | SIZE | DESCRIPTION / MATERIAL |
|---|---|---|---|
| 80122-24 | 1 | | ADAPTER |
| 80042-161 | 2 | | SPACER PLATE |
| 80022-44 | 2 | | BUSHINGS |
| 80022-21 | 2 | | |
| 40562-4 | 1 | | RIBS |
| 40562-3 | 1 | | |
| 40562-2 | 1 | | |
| 40551 | 1 | | HORN |
| -7 | — | | SUB ASSY OF [illegible] |
| -6 | | | [illegible] |
| -5 | | | [illegible] |
| -4 | | | [illegible] |
| -3 | | | [illegible] |
| -2 | 1 | 1X.035X2 1/2 | .025 STEEL TUBE |

SCALE 3=1FT. & NOTES — TOTAL WT.—LBS.
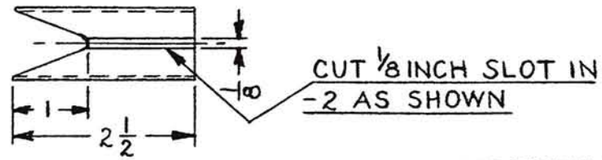
# ELEVATOR ASSEMBLY

| | | | | | | | |
|---|---|---|---|---|---|---|---|
| | | | | 35C | 2 | 41692 | |
| | | | | 38-44 | 2 | 41692 | |
| H | 2 each of 80042-16, 80022-21, 80022-44 Rem. Sym. -7. | 2-6-43 | PRF | | | | |
| G | REDRAWN & REVISED | 8-17-43 | PRF | | | | |
| WT. | REVISION | DATE | BY | MODEL | PER SHOP | WEIGHT LBS. | SUPERSEDES |

PIPER AIRCRAFT CORP. LOCK HAVEN, PENNA.

| DRAWN | CHECKED | APPROVED |
|---|---|---|
| R. FRANK 8-17-43 | C.K. 8-18-43 | |

MAY 3

40572